

A notebook for the diagnosis and maintenance of gravity-flow water systems



This practical guideline aims at helping persons in charge of organising and conducting (or facilitating) diagnoses of gravity systems. It presents a definition of what is meant by diagnosis, and situates the diagnosis in the different steps of a preventive maintenance process. After giving a general overview of the different components of a gravity system, a description of what must be looked at for each component is described. A summary table, in the form of a check-list is presented on the last page



What is a diagnosis?

A diagnosis of a gravity-flow system is an inspection of all the elements of the system (spring, pipeline, water points) to identify possible problems or risks, to assess their probability, and determine the consequent priorities to be given.

The diagnosis compares « how the system is » as regard to « how the system should be ». Starting with these differences, a list of remedial actions can be recommended in order to implement the required maintenance and bring the system (back) to an optimal state.

The diagnosis and the preventive maintenance process

The different steps: from the decision to conduct a diagnosis to the final validation:

1. Decision to conduct a diagnosis

To trigger the maintenance of the system, someone needs to take the initiative to plan a diagnossis of the system. The optimal frequency depends on different factors (number of users, number of water points, length of the pipeline, exposure to erosion...). But for all systems, it is necessary to conduct a diagnosis at least once per year.

2. The diagnosis of the system

The diagnosis can either be done directly by one or several trained person(s) of the village or may require the support of an external experienced person.

3. <u>Reporting</u> the recommendations

Communicating the results of the diagnosis is crucial to enable the Water Association and the users to get a clear picture of the state of their system and of the possible needs of intervention. Typically, the report includes:

- a brief presentation of the system and of the person(s) involved in the diagnosis + date
- the status of the yield and the water quality,
- a description of the risks or defaults observed on the system,
- the state of the protection perimeter of the spring,
- a list of recommendations,
- the proposed solutions and options, the priorities, an estimation of the budget range and an indicative schedule.

4. Action & budget plan


After the delivery of the diagnosis report and its validation by the Water Association, this latest has to present it to the users and get their consent on the measures to be implemented. From there, a precise action & budget plan can be established and scheduled.

5. Operating the maintenances

The required material is purchased and the maintenances are operated, possibly with the support of a local artisan, or a local contractor or expert for technically complicated operations.

6. Validation that the recommendations have been applied

This phase is essential to guarantee the quality of the work, especially when operated by an external contractor. The Water Association and possible a representative of the Federation and Water Office (mainly for heavier maintenance operation) should give a formal validation of the work.

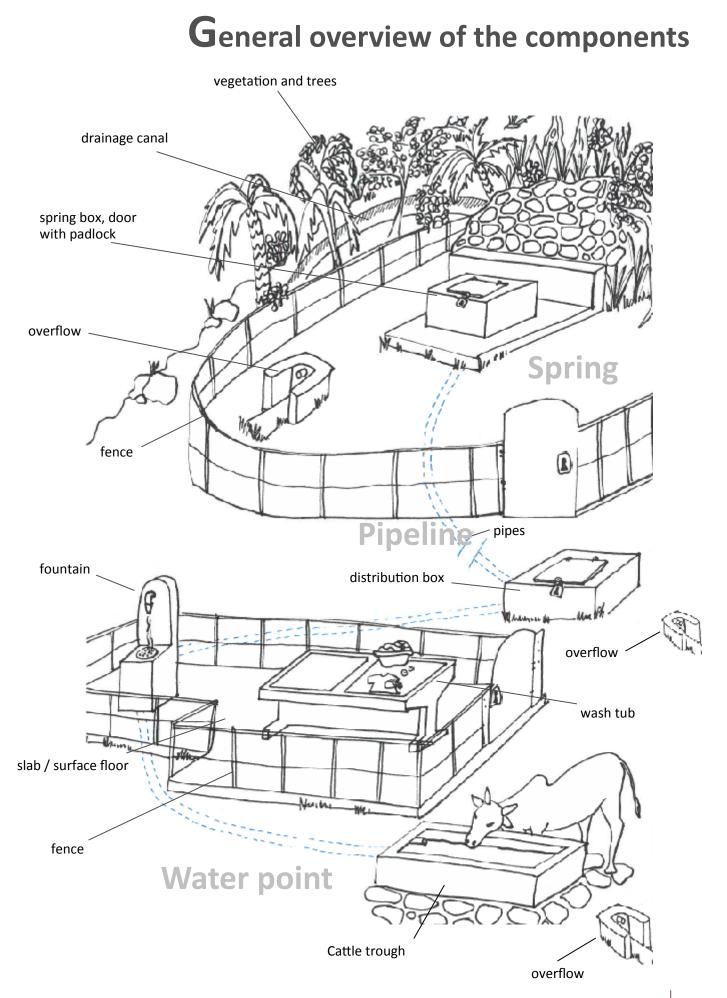



Description for each component

The spring and its surrounding

Manhole door, padlock and outer part of the box

The **door** allows a controlled access to the inside of the spring box. It must be closed with a **padlock** to prevent unauthorised access and must be hermetic to animals (birds, insects) and surface water infiltrations.



Possible problems and solutions

Lock not available or not functional	⇔	Introduce or replace lock/padlock
Rusting of metallic door surface & joints	⇒	First clean the rust with metallic brush. Apply antirust paint
Breakdown /dislocation of hinges and joints	L,	Welding of broken joints/hinges and assembling it to the box.
(metal-concrete)	-7	(Boring and refilling of concrete may be involved)
Major crack on masonry / plastering damaged	⇔	Repair broken/cracked part with cement



Inside the spring box

Inside the box, the water flows on a clean, smooth, and firm surface before being taken in the distribution pipes through one or several intake pipes. If there is more than one intake pipe, a regulation can be placed with small pieces of pipes in order to adjust the flow at the desired quantity in each of the pipes. One or several overflow pipes (depending on the yield) evacuate the excess water outside the box.

	Floor surface full of mud, debris, sediments, and other dead or live worms/insects	⇔	Regular cleaning/washing schedule required			
Floor surface (inside the box)	Floor surface deterioration by wear and tear	⇔	Apply cement mortar screed if the depth of deterioration is less than 5 cm. Otherwise apply concrete patching			
	Tree roots are developing inside the box	⇒	Regular cleaning/washing schedule required			
Overflow pipe	No pipe inserted or broken/damaged	⇔	Introduce or replace the piece of pipe (usually 10 cm of 75mm pipe)			
(inside the box)	Pipe too short or too long	⇒	Cut if the pipe is too long or replace is too short.			
	The intake of the overflow pipe should be at 10cm up from the floor.					
	No pipe (water enters at surface level)	⇒	Introduce piece of pipe			
Supply water	Pipe is too long (> 5cm)	⇒	Cut the pipe to appropriate size			
intake pipe	Unequal distribution between the different intakes	⇒	Replace or adjust intake pipe at equal level			
	The water intake should be at 3 to 5cm up from the floor.					

Outlet of the overflow and drainage of excess water

The **overflow** freely evacuates the excess water and allows washing out the sediments that accumulate inside the box. The outlet of the overflow is anchored in masonry and allows the water to flow out freely. If necessary, a grid is placed to avoid frogs and likes to enter into the pipe. After the outlet, the water is **drained** in a canal further to avoid having stagnant water close to the spring box

Possible problems and solutions

No or very poor/weak anchorage	⇒	 Introduce or repair the anchorage
Pipe end submerged by	⇔	Dig or increase drainage canal to allow the water to flow out
water/mud		freely. Improve canal slope if pipe submerged
Pipe end buried by soil/vegetation	⇒	 Clean canal if it is filled with mud/vegetation
Pipe clogged	⇒	 Unclog the pipe using long iron bar
Frogs or likes are present in the	⇒	 Install a grid or tight piece of iron bar to prevent frogs
pipe or in the box	~	entering into the pipe



Protection of the spring environment

- Earth retaining structures are located above the spring box and protect the box from overtopping of soil and prevent land slide that can harm the structure. These structures can be composed of dry or masonry wall, gabions or vegetalised wall. The protection canal diverts the flow of upstream surface water away from the structure and the surrounding.
- Antierosive measures including diversion canal in the upper part contribute to decrease the speed of the surface water and to limit soil erosion.
- The fence and protection perimeter prevent unwanted or unauthorized entrance of people and animal. It also secures and protects the perimeter of the spring against any pollutant. The vegetalisation of the spring watershed facilitates water infiltration in the water table and contributes to preserve the spring and to prevent yield reduction.

Earth retaining structures	Structure overtopped by surrounding soil	⇔	Remove the soil that overtopped. Introduce measures to reduce soil movement
Protection canal	Broken/damaged/ poor/ weak protection canals and cut off drain at the upstream of the structures	⇔	(Re)dig a large and solid protection canal
	Sign that indicate there is erosion flow toward the structure & surrounding	⇔	Introduce or repair the erosion protection works
Fence - protection perimeter	Fence not available or not strong	₽	Make or repair the fence
	Upstream side of the spring not sufficiently protected and vegetalised	⊳	Enlarge the protection perimeter. Plant vegetation and reforest the spring watershed
	Trees that pump too much water exist in the close vicinity of spring	⇒	Progressively replace trees that risk the system (i.e. eucalyptus) by more adapted varieties
	Trees that can damage the structure with their root system exist at close distance of the spring box	⇔	Cut the rooting part that risks the system. Keep the spring surrounding clean. Avoid development of small trees just close to the spring box

Water quality and quantity inspection

Spring Yield Inspection: the system has to supply a sufficient and reliable yield.

Significant amount of yield reduction can be verified by:

- Measurement of the yield : it can be done by calculating the time necessary to fill a bucket of a known volume. To obtain the yield in litter per second (I/s), divide the bucket volume by the calculated time in second.
- Investigating possible seepages around the foundation of the spring box
- Interview of land owner and local people

In order to preserve the yield of a spring, solutions can be undertaken to better protect and treat the "recharge area", mainly by planting adapted trees and vegetation.

If water is flowing or seeping outside the spring box, an extension of the retention wall may be necessary, but such solutions usually require the rehabilitation of the entire spring box.

<u>Quality Inspection</u>: the system has to supply safe and uncontaminated water to the users. During the diagnosis, one will observe the temperature of the water (it should be fresh), its turbidity and its taste. If any doubts, further analysis will be necessary consisting in bacteriological analysis (+possibly chemical) as well as pH and turbidity measurements

If physical, chemical and bacteriological standards of water quality are not met, solution might be found in

- Enlarging the spring protection perimeter
- Isolating contamination sources (such as latrines , animal grazing, open defecation areas in the spring environment)


If the problem remains, chemical treatment has to be applied to the reservoir (if any) or/and at household level




The reservoir

At reservoir level (if any), one will control the cleanliness of the inside part, the absence of leakage and the state of the masonry, the fence, the state of manhole door which should be locked and waterproof, the functionality of the overflow and the drainage of excess water when the reservoir is full.

Possible problems and solutions ⇒ see outside part and inside part of the spring box

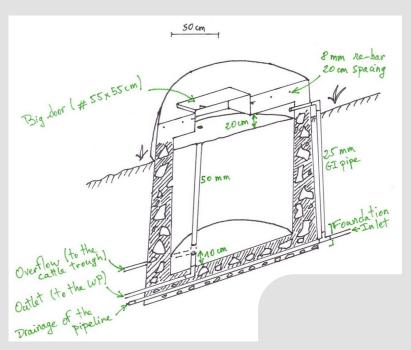



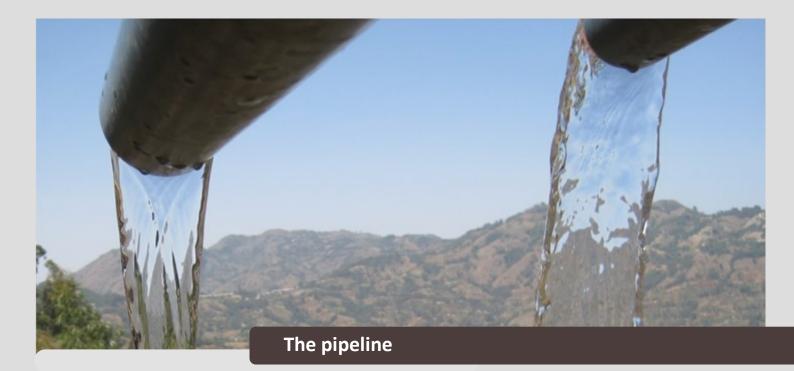

The diagnosis of the pipeline ensures that the water is carried from one point (the spring or a distribution box) up to another (usually, a water point) without affecting both its quantity and its quality. For that, it is necessary to inspect the pipeline and its surroundings all along the line, with a particular attention given to exposed areas like stream or gulley crossing. One should make sure that the pipes are well buried and protected (pipes cannot be exposed). Leakages can be detected by observing possible trace of moistures on the floor around the pipeline and by comparing yield at the intake and outlet of a set of pipes.

Possible	problems and solutions	

Buried pipes	Breakdown or leakage that causes drying or reduction of flow in the line	⇔	Repair or replace the pipe (usually by cutting the defect part with a piece of pipe and the corresponding coupling)	
	Exposed pipes (not covered below sufficient depth)	⇔	Burry the exposed part of the line with compacted soil, or stone/gravel + compacted soil + stone again on the top	
	Risk of land slide	⊳	Introduce dry masonry structure to stabilize the slope, plant vegetation to stabilise the soil	
Over hanging or surface laid pipes	Anchorage problems	⇒	Repair masonry; consolidate the structure of the anchorage with iron bars if necessary.	
	Suspension cables and joint problems	⇔	Retight/replace suspension cables. Protect them with barbed wire to avoid any persons accessing the cables.	
	Pipe breakdown or damage at the overhanging section	⇔	Replace the damaged pipes. Pass PVC/HDP pipe inside galvanised pipe of higher diameter for the exposed pipeline section to ensure durable protection.	
	If complicated refer/consult higher technical/engineering level			



Diagnosis of gravity-flow systems



The water point

The fountain

The fountain is usually composed of:

- <u>A slab</u> on which the fountain stands . The slab allows the users to walk on a clean, firm and not slippery floor in order to fetch water easily . A major role of the slab is to drain out the water from splashes or heavy rains to ease the access. The slab must be easy to wash regularly.
- <u>An outlet pipe giving</u> a continuous flow of sufficient water that can easily be fetched (non-splashing and controlled flow). When there is a reservoir, a tap (local or talbo) is installed.
- <u>A standing concrete column</u> that must be well anchored to protect the pipe from any damage.

Possible problems and solutions

Slab (floor surface)	Surface water evacuation problem	Ŷ	Improve the slope of the floor surface. Ensure that the flowing water is well drained (also around the slab) to avoid stagnant water around the water point.
	Surface not clean	⇔	Regular washing/cleaning schedule required
	Deterioration/crack on the surface	₽	Cement screed or concrete patching depending on the depth of deterioration
Fountain outlet,	Clogged pipe (no or partial flow)	仓	Unclog using wire or iron bar and opening the end cap
taps and valves	Broken/lost end pipe	⇒	Repair or replace the broken or lost part
	Taps/valves not functional, leaking or faulty	⇔	Repair or replace the broken or lost part
Flow conditions	No or decrease flow / intermittent flow	⇔	Check upstream on the pipeline Unscrew the flush valve on the side of the slab to evacuate possible accumulated sediments.
Standing concrete	Minor damage and/or cracks	₽	Apply cement mortar plastering and rendering
column	Major damage and severe deterioration	⇒	Heavy repair or rehabilitation required

• The wash table


For the wash table, one will check that its surface is smooth washing the laundry; that the main concrete structure is not cracked or damaged; and that the excess water evacuates properly from the washing tub and the floor and does not stagnate around the water point

	Surface water evacuation problem	⇒	Improve the slope of the floor surface
Washing surface	Deterioration/crack on the surface	⇔	Redo the plastering. First, make the floor rough so that the plaster can properly adhere on it.
Evacuation and drainage	Clogged pipe for the evacuation of excess water	⇒	Unclog using wire or iron bar
	Stagnant water around the wash table	⇔	Improve the canal to drain the water out of the water point surrounding
Main concrete structure	Minor damage and/or cracks	⇔	Enlarge the crack and apply cement/concrete patch on it.
	Major damage and severe deterioration	⇒	Heavy repair or rehabilitation required

The cattle trough

Beyond checking the state of the masonry and the cleanness of the trough and access path for the cattle, one will ensure that water is always full in the trough (unless it is drained for cleaning) and that the excess water evacuates well, and that the water is clean. Particular attention will be given to the cleanliness of the water to prevent the development of leeches and worms that can be brought by some of the animals.

	Overflow pipe absent or damaged	⇒	Replace the piece of pipe
	Overflow pipe hard to remove	⇔	Polish the end of the pipe with paraffin wax (from candles)
Pipe, overflow and	Pipes are exposed to the air	⇔	Burry the exposed part of the line with compacted soil + stone on the top
drainage	No or very poor/weak anchorage	⇒	Introduce or repair the anchorage
	Pipe end submerged by water/mud or buried by soil/vegetation	⇔	Dig canal or clean it to allow water to evacuate freely. Improve canal slope if pipe submerged
	Clogged pipe for the evacuation of excess water	⇒	Unclog the pipe using long iron bar
	Cattle trough not clean (sediment, leeches)	⇒	Regular washing/cleaning schedule required
Cleanness and accessibility	Mud and stagnant water around the cattle trough	⇔	Improve drainage canal and make stone pavement around the trough
	Poor access for the cattle	⇔	Enlarge the path, decrease slopes, place stone pavements
Main concrete	Minor damage and/or cracks	⇔	Enlarge the crack and apply cement/concrete patch on it.
structure	Major damage and severe deterioration	⇒	Heavy repair or rehabilitation required

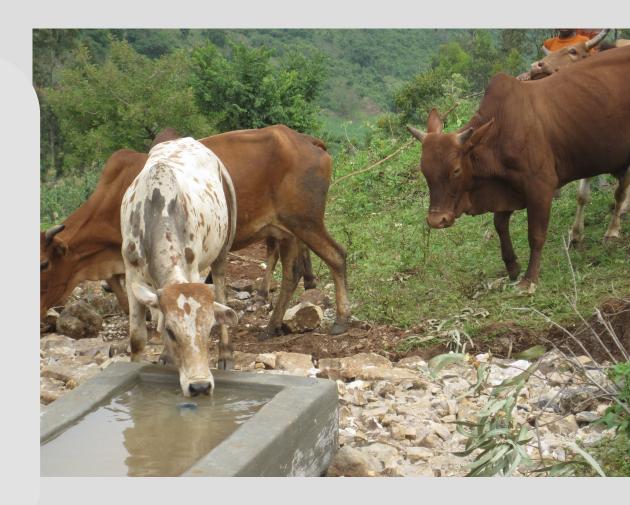



Technical check list

FLEMENT DAtt IDERCIECTION IDE A padiock is functional Immediatic door is well painted, with no rust and not hole Immediatic door is well painted, with no rust and not hole Immediatic door is well painted, with no rust and not hole padiock, outside part of spring box Immediatic door is well painted, with no rust and not hole Immediatic door is well fixed on the hinges and open/close correctly. The inside part of the spring box Immediatic door is smooth with no deterioration Immediatic door is mooth water infiltration The inside part of the spring box The surface floor is smooth with no deterioration. Immediatic door is mooth with no deterioration. SERING Overflow outlet and drainage of the lock pipe section above the surface floor = nak 5cm Immediatic door is mooth with no deterioration. SERING Overflow outlet and drainage of the lock pipe section above the surface floor = nak 5cm Immediatic door is mooth with a set of the surface floor = nak 5cm SERING Overflow outlet and drainage of users in otcloged indiate the overflow pipe Immediate and the surface floor = nak 5cm SERING Overflow outlet and drainage of the surface floor = nak 5cm Immediate and the surface floor = nak 5cm SERING Overflow outlet and drainage of the surface anond the synface anone Immediate ano surface anone	к 😿
SPRING A padiock is functional Manhole door, part of spring box The metalic door is well fixed on the hinges and open/close correctly The close of spring box The close of the concrete box is mooth the spring of the outside part of the concrete box is mooth. The inside part of the spring box The surface floor is sen (absence of any sediment). The inside part of the spring box The surface floor is sen (absence of any sediment). The inside part of the spring box The surface floor is sen (absence of any sediment). The inside part of the spring box The surface floor is som (absence of any sediment). The inside part of the spring hox. The surface floor is som (absence of any sediment). The surface floor is som (absence of any sediment). The surface floor is som (absence of any sediment). The surface floor is som (absence of any sediment). The surface floor is som (absence of any sediment). The surface floor is som (absence of any sediment). The surface floor is som (absence of any sediment). The sec of the intake pipe section above the surface floor = 10cm The issue of the intake pipe section above the surface floor = 10cm The sec of the intake pipe section above the surface floor = max Scm The sec of the intake in each pipe is on tower on submerged by water, mud, vegetation). Excess water is not clogged inside the ove	
Manhole door, part of spring box The door is well fixed on the hinges and open/close correctly Image: Correct box is berned to the outside part of the concrete box No cracks are observed inside to be well the outside part of the concrete box is smooth Image: Concrete box is hermetic to any external water infiltration The inside part of The surface floor is clean (absence of any sediment) Image: Concrete box is hermetic to any external water infiltration The inside part of The surface floor is clean (absence of any sediment) Image: Concrete box is hermetic to any external water infiltration The inside part of The presention water and the overflow pipe section above the surface floor = 10cm Image: Concrete box is hermetic to any external water infiltration The surface floor is clean (absence of any sequal or corresponds to the desired yield Image: Concrete box is hermetic to any external water infiltration The surface floor is clean (absence of any sequal or corresponds to the desired yield Image: Concrete box is hermetic to any clean clean concrete box is cut The overflow outet Water concrete is well finded after the overflow pipe Excess water Excess water is not cleagad inder surged by water, mud, vegetation) Excess water Excess water is not cleagad or concret any of the spring so is cut Apod protection of the spring is not overflow pipe Image: concret any of the spring is stable as co	
pation pation<	
Part of spring box No cracks are observed on the outside part of the concrete box smooth The plastering of the outside part of the concrete box is mooth The plastering of the outside part of the concrete box is mooth The inside part of The surface floor is clean (absence of any sediment) The surface floor is clean (absence of any sediment) The inside part of The surface floor is clean (absence of any sediment) The surface floor is clean (absence of any sediment) The inside part of The plaster floor is clean (absence of any sediment) The inside part of The isace of the overflow pipe section above the surface floor = 10cm The size of the intakes the intake is cell installed The size of the intakes the intake is near bipe is equal or corresponds to the desired yield The overflow outet is well anchored Water can flow out freely a toutife (abjee not submerged by water, mud, vegetation) Excess water is not cloged inside the overflow pipe Excess water is not cloged period of the overflow pipe Excess water is not cloged period to the direct around the spring clost out Apoid protection of the spring box in ot vertopped by surrounding soil The respring box is not vertopped by surrounding soil The vertex out is a seping is soil as a compared to previous yeas The upstream side of the spring is statia as compared to previous yeas There are no sign of there pring is statia as comp	
SPRING Image: Display and the private provided privation of the outside part of the outside part of the spring box Image: Display and the private prithe private private private prithe prithe private private privat	
SPRING The surface floor is clean (absence of any sediment) In the surface floor is smooth with no deterioration SPRING The inside part of the spring box The surface floor is smooth with no deterioration In the spring box SPRING Overflow outed the spring box The inside part of the overflow pipe section above the surface floor - 10cm In the spring box Overflow outed and drainage of excess water The size of the overflow pipe section above the surface floor - max 5cm If several intakes: the intake in each pipe section above the surface floor - max 5cm Protection of the and drainage of excess water is not clogged inside the overflow pipe Excess water is not clogged inside the overflow pipe Protection of the spring box is not overtoppeed by surrounding soil The vegetation in the 3m circle around the spring box is cut A good protection canal diverts numoff water at upstream of the spring catchment A fence avoid unauthorised persons to enter the spring catchment area The userteam side of the spring is softened In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing Water quantity and quality inspection The water quality tests have shown absence of coliforms A perimeter around the spring is stable as compared to previous years The water on the spring is stable as compared to previous years The water on the sporing is stable as compared to p	
PREMINE Water quantity and quality stables The surface floor is smooth with no deterioration Image: the spring box SPRING The inside part of the spring box The size of the overflow pipe section above the surface floor = 10cm The size of the overflow pipe section above the surface floor = max 5cm The size of the intake in each pipe is equal or corresponds to the desired yield SPRING Overflow outlet and drainage of the spring box is not verflow pipe section above the surface floor = max 5cm The size of the intake in each pipe is equal or corresponds to the desired yield SPRING Overflow outlet of the swell include the intex overflow pipe section above the surface floor = max 5cm The overflow outlet is well anchored The overflow pipe section above the surface floor = max 5cm SPRING Overflow outlet overflow pipe section above the surface floor = mox 5cm The several intakes: the intake in each pipe is equal or corresponds to the desired yield The overflow outlet overflow pipe section above the surface floor = max 5cm The vereal intake in each pipe is equal or corresponds to the desired yield Protection of the spring box is not overtopped by surrounding soil The vegetation in the 3m circle around the spring part the overflow pipe section and adapted trees Protection of the spring is data in the in the overflow pipe section shows The vegetation and adapted trees The upetraemaris due of the spring is stable as compared to previous	
PREMINE Water quantity and quality stables The surface floor is smooth with no deterioration Image: the spring box SPRING The inside part of the spring box The size of the overflow pipe section above the surface floor = 10cm The size of the overflow pipe section above the surface floor = max 5cm The size of the intake in each pipe is equal or corresponds to the desired yield SPRING Overflow outlet and drainage of the spring box is not verflow pipe section above the surface floor = max 5cm The size of the intake in each pipe is equal or corresponds to the desired yield SPRING Overflow outlet of the swell include the intex overflow pipe section above the surface floor = max 5cm The overflow outlet is well anchored The overflow pipe section above the surface floor = max 5cm SPRING Overflow outlet overflow pipe section above the surface floor = mox 5cm The several intakes: the intake in each pipe is equal or corresponds to the desired yield The overflow outlet overflow pipe section above the surface floor = max 5cm The vereal intake in each pipe is equal or corresponds to the desired yield Protection of the spring box is not overtopped by surrounding soil The vegetation in the 3m circle around the spring part the overflow pipe section and adapted trees Protection of the spring is data in the in the overflow pipe section shows The vegetation and adapted trees The upetraemaris due of the spring is stable as compared to previous	<u> </u>
Protection of the spring box No roots are observed inside the box SPRING The isse of the overflow pipe section above the surface floor = 10cm The size of the overflow pipe section above the surface floor = as Xcm If several intakes: the intake in each pipe is equal or corresponds to the desired yield The overflow outlet The overflow outlet is well anchored The overflow outlet is well anchored Overflow outlet Water can flow out freq ety at outlet (pipe not submerged by water, mud, vegetation) Excess water Excess water is not clogged inside the overflow pipe Excess water Excess water is well anchored No tack of frogs or likes in the in the overflow pipe The spring box is not overtopped by surrounding soil The vegetation in the ab circle around the spring box is cut A good protection canal diverts runoff water at upstream of the spring catchment A face avoid unauthorised persons to enter the spring catchment and A face avoid unauthorised persons to enter the spring catchment and A perimeter around the spring is protected by vegetation, animal grazing No water is seeping outside the box Water quantity and The vield of the spring is stable as compared to previous years The water appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Absence of leak	
PRIME the spring box The size of the overflow pipe section above the surface floor = 10cm SPRING The size of the instake pipe section above the surface floor = max 5cm If If several intakes: the intake in each pipe is equil on southe surface floor = max 5cm If If several intakes: the intake in each pipe is equil or corresponds to the desired yield It If several intakes: the intake in each pipe is equil or corresponds to the desired yield Excess water is not clogged inside the overflow pipe Excess water Excess water is sulf andined aftert the overflow pipe It Excess water is sulf andined aftert the spring catchment The spring box is not overtopped by surrounding soil The spring box is not overtopped by surrounding soil The vegetation in the 3m circle around the spring catchment The are no sign of resoin that could affect the spring catchment The upstream side of the spring is protected by vegetation and adapted trees The upstream side of the spring is stable as compared to previous years The vield of the spring is stable as compared to previous years Valet quantity and the pipeline shows No water is seeping outside the box No pipes that should be buried are exposed to the air No risk of landside or erosion No water appars to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms	-
PRING the spring box The size of the overflow pipe section above the surface floor = max 5cm Imax 5cm SPRING Overflow outlet and drainage of excess water The size of the intake in each pipe is equal or corresponds to the desired yield Overflow outlet and drainage of excess water The soverflow outlet swell anchored Imax 5cm Protection of the spring environment The soverflow outlet swell anchored Imax 5cm Protection of the spring environment The soverflow outlet swell anchored Imax 5cm Vater quantity and quality inspection The spring shox is not overtopped by surrounding soil Imax 5cm The vergetation in the 3m circle around the spring catchment The vergetation in the 3m circle around the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees The vergetation in the spring is defined Water quantity and quality inspection The vergetame of ond anot unitation sources: latrine, open defecation, animal grazing No water is seeping outside the box The vergetame adages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air No mater appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of conforms Absence of leakages (no moisture observed on the pipeline)	1
SPRING This overflow pipe section can easily be removed and re-installed The size of the intake pipe section above the surface floor = max 5cm	1
SPRING The size of the intake pipe section above the surface floor = max Scm If several intakes: the intake in each pipe is equal or corresponds to the desired yield SPRING Overflow outlet and drainage of excess water The overflow outlet is well anchored Water can flow out freely at outlet (pipe not submerged by water, mud, vegetation) Excess water is not clogged inside the overflow pipe Excess water is not clogged inside the overflow pipe Protection of the spring environment The spring box is not overtopped by surrounding soil The vegetation in the 3m circle around the spring box is cut A fence avoid unauthorised persons to enter the spring catchment The reare no trees growing just near to the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees The vegetation in the spring is protected by vegetation and adapted trees Water quantity and quality inspection The vield of the spring is stable as compared to previous years Waking all along the pipeline shows: Absence of leakages (no moisture observed on the pipeline) No budle is of the spring is stable as compared to previous years No pipes that should be buried are exposed to the air No pipes that should be buried are exposed to the air No pipes that should be buried are exposed to the air No water is specing outside the box No pudeles of water on the slab, surface water evacuates well maintai	+
SPRING If several intakes: the intake in each pipe is equal or corresponds to the desired yield SPRING The overflow outlet and drainage of excess water The overflow routlet is well anchored SPRING Overflow outlet and drainage of excess water Excess water (pipe not submerged by water, mud, vegetation) For excess water Excess water is well drained after the overflow pipe Excess water is well drained after the overflow pipe Protection of the spring environment The spring box is not overtopped by surrounding soil The vegetation in the 3m circle around the spring box is cut A pool protection can al divers trunchf water at upstream of the spring catchment The upstream side of the spring is protected by vegetation and adapted trees There are no sign of erosion that could affect the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees Water quantity and quality inspection No water is seeping outside the box The vield of the spring is stable as compared to previous years Water quantity and quality inspection No water is seeping outside the box Absence of leakages (no moisture observed on the pipeline) No risk of landslide or erosion No risk of landslide or erosion No risk of landslide or erosion Stream crossing, surface laid pipes in suspended and exposed pipes are well connected, with no leakages or disjoint	+
SPRING Overflow outlet is well anchored Water can flow out freely at outlet (pipe not submerged by water, mud, vegetation)	1
SPRING Overflow outlet and drainage of excess water Water can flow out freely at outlet (pipe not submerged by water, mud, vegetation) Excess water Excess water is not clogged inside the overflow pipe Image: constraint of the spring box is not overflow pipe Protection of the spring environment The spring box is not overcopped by surrounding soil Image: constraint of the spring catchment area The upstream side of the spring is protected by vegetation in the 3m circle around the spring catchment area Image: constraint of the spring catchment area Water quantity and quality inspection Image: constraint of the spring is protected by vegetation and adapted trees Water quantity and quality inspection The vield of the spring is defined Mater appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Stream crossing, surface laid pipes in rocky places Exopeed prises of the spring is supende cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No risk of landslide or erosion No puddles of water on the slab, surface well and pipes in rocky places No puddles of water on the slab, surface well and rot of the suspended and exposed pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface weaterevacuates wellou tof the slab No puddles of water	+
SPRING and drainage of excess water Excess water is not clogged inside the overflow pipe Excess water Excess water is well drained after the overflow pipe Itexess water is well drained after the overflow pipe Protection of the spring environment The spring box is not overtopped by surrounding soil Itexess water at upstream of the spring catchment A force avoid unauthorised persons to enter the spring catchment area There are no sign of erosion that could affect the spring catchment area There are no trees growing just near to the spring box A perimeter around the spring is protected by vegetation and dapted trees There are no trees growing just near to the spring box A perimeter around the spring is defined In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box Water quantity and quality inspection The vield of the spring is stable as compared to previous years The vield of the spring is stable are compared to the pipeline) No risk of landslide or erosion Surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained The wards oppeared to be supering pipes over stream crossing are well maintained No racks of deterioration observed on the slab (surface is smooth) <t< td=""><td>+</td></t<>	+
VATER Water Excess water Excess water is well drained after the overflow No tack of frogs or likes in the in the overflow pipe The spring box is not overtopped by surrounding soil The vegetation in the 3m circle around the spring box is cut A good protection canal diverts runoff water at upstream of the spring catchment The vegetation in the 3m circle around the spring box is cut A fence avoid unauthorised persons to enter the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees The upstream side of the spring is defined In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box The vield of the spring is stable as compared to previous years The vield of the spring is stable as compared to previous years The vield of the spring is stable as compared to previous years Walking all along Asence of leadages (no motisture observed on the pipeline) No risk of landslide or erosion Stream crossing, Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain No cracks or deterioration observed on t	+
Protection of the spring environment The spring box is not overtopped by surrounding soil Image: the spring box is not overtopped by surrounding soil Protection of the spring environment The spring box is not overtopped by surrounding soil Image: the spring box is not overtopped by surrounding soil Water quantity and quality inspection A fence avoid unauthorised persons to enter the spring catchment area Image: the upstream side of the spring is protected by vegetation and adapted trees Water quantity and quality inspection No water is seeping outside the box Image: the vater appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air No pises that should be buried are exposed to the air No cracks or deterioration observed on the pipeline Suspended cable to suspend pipes over stream crossing are well maintained Surface laid pipes in rocky places Suspended cable to suspend pipes over stream crossing are well on the slab Fountain The warker of the slab is kept clean (no mud or dirt) No cracks or deterioration observed on the slab (surface is smooth) The warker of the slab is kept clean (no mud or dirt) No cracks or deterioration observed on the cleakage or dilty the surface of the slab is kept clean (no mud or dirt) No cracks or	+
Protection of the spring environment The spring box is not overtopped by surrounding soil A good protection canal diverts runoff water at upstream of the spring catchment A fence avoid unauthorised persons to enter the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees The rear on otice spring is protected by vegetation and adapted trees The reare no trees growing just near to the spring box Water quantity and quality inspection No water is seeping outside the box Water quantity and quality inspection No water is seeping outside the box Water quantity and quality inspection A perimeter around the spring is defined In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box Water quantity and quality inspection Absence of leakages (no moisture observed on the pipeline) No visk of landside or erosion Absence of leakages (no moisture observed on the air No risk of landside or erosion Suspended cable to suspend pipes over stream crossing are well maintained Suspended cable to suspend pipes over stream crossing are well maintained Suspended and expoced pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab The water appears to be clean in the daby furface is smooth)	+
Protection of the spring environment The vegetation in the 3m circle around the spring box is cut A good protection canal diverts runoff water at upstream of the spring catchment Here are no sign of erosion that could affect the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees There are no trees growing just near to the spring box A perimeter around the spring is protected by vegetation and adapted trees Water quantity and quality inspection No water is seeping outside the box Water quantity and quality inspection No water is seeping outside the box Water quantity and quality inspection Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air no rocky places Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No cracks or deterioration observed on the slab Feountain The work of the slab is kept clean (no mud or dirt) No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe. Walking all along the pipeline shows: No cracks or deterioration observed on the slab (surface is smooth) No rack or deterioration observed on the slab.	+
Protection of the spring environment A good protection canal diverts runoff water at upstream of the spring catchment A fence avoid unauthorised persons to enter the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees The upstream side of the spring is protected by vegetation and adapted trees The upstream side of the spring is defined In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box Water quantity and quality inspection No water is seeping outside the box The yield of the spring is stable as compared to previous years Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No risk of landslide or erosion Stream crossing, surface laid pipes in soused pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab The washout pipe is easily accessible Fountain Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The washout pipe is easily accessible Fountain Fountain in the ountain is well adjusted above the receiver pipe. Water Rewash table	+
Protection of the spring environment There are no sign of erosion that could affect the spring catchment area Here avoid unauthorised persons to enter the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees The upstream side of the spring is protected by vegetation and adapted trees The upstream side of the spring is protected by vegetation and adapted trees Water quantity and quality inspection In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box The vield of the spring is stable as compared to previous years The water appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No risk of landslide or erosion Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Fountain Suspended and exposed pipes are well connected, with no leakages or disjoint No cracks or deterioration observed on the slab (surface is smooth) The wate flowing in the fountain is well absorbed in the receiver pipe, which is not clogged The wathout pipe is easily accessible Fountain outlet is nort broken and well adjusted above the receiver pipe, which is not clogged The wathout pipe is normal No cracks or deterioration observed on the fountain concrete struct	+
Protection of the spring environment A fence avoid unauthorised persons to enter the spring catchment area The upstream side of the spring is protected by vegetation and adapted trees There are no trees growing just near to the spring box A perimeter around the spring is offined In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing Water quantity and quality inspection No water is seeping outside the box The will along the pipeline shows: No water is seeping outside the box Watking all along the pipeline shows: Absence of leakages (no moisture observed on the pipeline) No risk of landslide or erosion No risk of landslide or erosion Stream crossing, surface laid pipes in rocky places Suspended cable to suspend pipes over stream crossing are well maintained Suspended cable to suspend pipes are well connected, with no leakages or disjoint No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain Fountain nutlet is not broken and well adjusted above the receiver pipe WATER Wash table No pudles or metain new shale surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration)	+
PIPELINE Waking all along the pipeline shows: Exposed parts of the sping is even using are well and on the sping are well and the sping are sping and the sping are well and the sping are sping and the sping are well and the sping are sping and the sping are sping and the sping are well and the sping are sping and the sping a	+
PIPELINE There are no trees growing just near to the spring box A perimeter around the spring is defined Water quantity and quality inspection In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box Water quantity and quality inspection The yield of the spring is stable as compared to previous years In the water appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air No pipes that should be buried are exposed to the air No risk of landslide or erosion Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well concetted, with no leakages or disjoint No nicks or deterioration observed on the slab (surface water evacuates well out of the slab The washout pipe is easily accessible Fountain Fountain the fountain is well absorbed in the receiver pipe. Which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles or deterioration observed on the fountain is well absorbed in the receiver pipe. Which is not clogged	+
PIPELINE A perimeter around the spring is defined In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing No water is seeping outside the box A Water quantity and quality inspection No water is seeping outside the box In the yeil of the spring is stable as compared to previous years In the yeil of the spring is stable as compared to previous years PIPELINE Walking all along the pipeline shows: Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air No risk of landslide or erosion Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint Fountain No puddles of water on the slab, surface water evacuates well out of the slab In the washout pipe is easily accessible Fountain Fountain Fountain is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, water flowing in the fountain is well absorbed on the fountain concrete structure No cracks or deterioration observed on the fountain concrete structure WATER Wash table No cracks or deterioration observed on the fountain concrete structure No cracks or deterioration observed on the fountain concrete structure No cracks o	+
PIPELINE In the perimeter, absence of contamination sources: latrine, open defecation, animal grazing Water quantity and quality inspection No water is seeping outside the box In The yield of the spring is stable as compared to previous years In The water appears to be clean, cold and not turbid In Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No risk of landslide or erosion Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain No puddles of water on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe. Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No cracks or deterioration observed on the fountain concrete structure No water duality is smooth (no crack or deterioration)	+
Vater quantity and quality inspection No water is seeping outside the box The yield of the spring is stable as compared to previous years The water appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air No pipes that should be buried are exposed to the air Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended cable to suspend pipes over stream crossing are well out of the slab Fountain No puddles of water on the slab, surface water evacuates well out of the slab No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The flow at fountain level is normal No puddles remaining on the wash table	
Water quantity and quality inspection The yield of the spring is stable as compared to previous years The water appears to be clean, cold and not turbid The water appears to be clean, cold and not turbid Previous/recent water quality tests have shown absence of coliforms Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air No pipes that should be buried are exposed to the air No risk of landslide or erosion Exposed parts of the pipeline are well anchored Surface laid pipes in rocky places Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab The washout pipe is easily accessible Fountain No puddles of water on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged)	+
PIPELINE The water appears to be clean, cold and not turbid Image: clean cold and clean cold and not turbid Image: clean cold and clean cold and clean cold and exposed to the air Image: clean cold and exposed pipes over stream crossing are well maintained Image: clean cold and exposed pipes are well connected, with no leakages or disjoint Image: clean cold and and clean cold and clea	+
PIPELINE Walking all along the pipeline shows: Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended cable to suspend pipes over stream crossing are well maintained Fountain No puddles of water on the slab, surface water evacuates well out of the slab Interstream construction observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain Fountain is well absorbed in the receiver pipe WATER Wash table No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration)	+
PIPELINE Absence of leakages (no moisture observed on the pipeline) Absence of leakages (no moisture observed on the pipeline) PIPELINE Walking all along the pipeline shows: Absence of leakages (no moisture observed on the pipeline) No pipes that should be buried are exposed to the air Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab No cracks or deterioration observed on the slab (surface is smooth) The surface of the slab is kept clean (no mud or dirt) No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration)	_
PIPELINE Waiking all along the pipeline shows: No pipes that should be buried are exposed to the air No risk of landslide or erosion Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended cable to suspend pipes over stream crossing are well maintained No puddles of water on the slab, surface water evacuates well out of the slab No puddles of water on the slab, surface water evacuates well out of the slab Fountain No cracks or deterioration observed on the slab (surface is smooth) No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe. Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration) The surface plaster is smooth (no crack or deterioration)	
PIPELINE The pipeline shows: No risk of landslide or erosion Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No risk of landslide or erosion Suspended and exposed pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab No cracks or deterioration observed on the slab (surface is smooth) The surface of the slab is kept clean (no mud or dirt) No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration)	—
PIPELINE Stream crossing, surface laid pipes in rocky places Exposed parts of the pipeline are well anchored Suspended cable to suspend pipes over stream crossing are well maintained Suspended cable to suspend pipes over stream crossing are well maintained No puddles of water on the slab, surface water evacuates well out of the slab No puddles of water on the slab, surface water evacuates well out of the slab Fountain No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged)	—
Surface laid pipes in rocky places Suspended cable to suspend pipes over stream crossing are well maintained Suspended and exposed pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab Fountain No puddles of water on the slab, surface water evacuates well out of the slab No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration) The surface plaster is smooth (no crack or deterioration)	┿━
rocky places Suspended and exposed pipes are well connected, with no leakages or disjoint No puddles of water on the slab, surface water evacuates well out of the slab No puddles of water on the slab, surface water evacuates well out of the slab Fountain No cracks or deterioration observed on the slab (surface is smooth) No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration) The surface plaster is smooth (no crack or deterioration)	—
Fountain No puddles of water on the slab, surface water evacuates well out of the slab Fountain No cracks or deterioration observed on the slab (surface is smooth) The washout pipe is easily accessible Fountain outlet is not broken and well adjusted above the receiver pipe Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged Taps (if any) are working properly, with not leakage or faulty The flow at fountain level is normal No cracks or deterioration observed on the fountain concrete structure No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration) The surface plaster is smooth (no crack or deterioration)	<u> </u>
WATER Wash table The surface of the slab is kept clean (no mud or dirt) Image: No cracks or deterioration observed on the slab (surface is smooth) WATER Wash table The surface plaster is smooth (no crack or deterioration observed on the slab surface (water well drained)	
WATER Wash table No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration)	—
WATER Wash table The wash table The wash table The wash table The washout pipe is easily accessible Image: Comparison of the section of the sectin of the section of the sectin of the secting of the se	——
WATER Wash table Fountain Fountain outlet is not broken and well adjusted above the receiver pipe Image: State of the stat	—
WATER Wash table Wash table Water flowing in the fountain is well absorbed in the receiver pipe, which is not clogged WATER Wash table No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) The surface plaster is smooth (no crack or deterioration)	<u> </u>
WATER Wash table Taps (if any) are working properly, with not leakage or faulty Image: Construction of the flow at fountain level is normal Image: Construction of the flow at fountain level is normal Image: Construction of the flow at fountain level is normal Image: Construction of the flow at fountain level is normal Image: Construction of the flow at fountain level is normal Image: Construction of the flow at fountain level is normal Image: Construction of the flow at foundation of the flow at flow at flow at flow at foundation of the flow at flo	—
WATER Wash table The flow at fountain level is normal Image: No cracks or deterioration observed on the fountain concrete structure Image: No cracks or deterioration observed on the fountain concrete structure Image: No cracks or deterioration observed on the fountain concrete structure Image: No cracks or deterioration observed on the fountain concrete structure Image: No cracks or deterioration Image: N	—
WATER Wash table No cracks or deterioration observed on the fountain concrete structure Image: Concrete structure	—
WATER No puddles remaining on the wash table surface (water well drained) Excess water evacuates freely (evacuation pipe not clogged) POINT The surface plaster is smooth (no crack or deterioration) Image: Comparison of the surface plaster is smooth (no crack or deterioration)	—
WATER Excess water evacuates freely (evacuation pipe not clogged) POINT The surface plaster is smooth (no crack or deterioration)	<u> </u>
WATER Wash table The surface plaster is smooth (no crack or deterioration)	
POINT Wash table The surface plaster is smooth (no crack or deterioration)	—
No stagnant water observed around the wash table	—
	—
The table structure has no crack or deterioration	<u> </u>
The water arrives well in the cattle trough	—
The water inside the trough is clean (no presence of leeches or sediments)	\downarrow
Cattle trough The overflow pipe is present and can be removed/re-installed easily	┥—
Excess water evacuates freely (overflow pipe not clogged)	┥—
The cattle trough concrete structure has no major cracks or deterioration signs	<u> </u>
Pipe, overflow, V(the set flow outlet is well anchored	
drainage and Water can flow out freely at the outlet (pipe not submerged by water, mud, vegetation)	
No pipes are exposed to open air	
The fountain (and wash table) is protected by a fence	